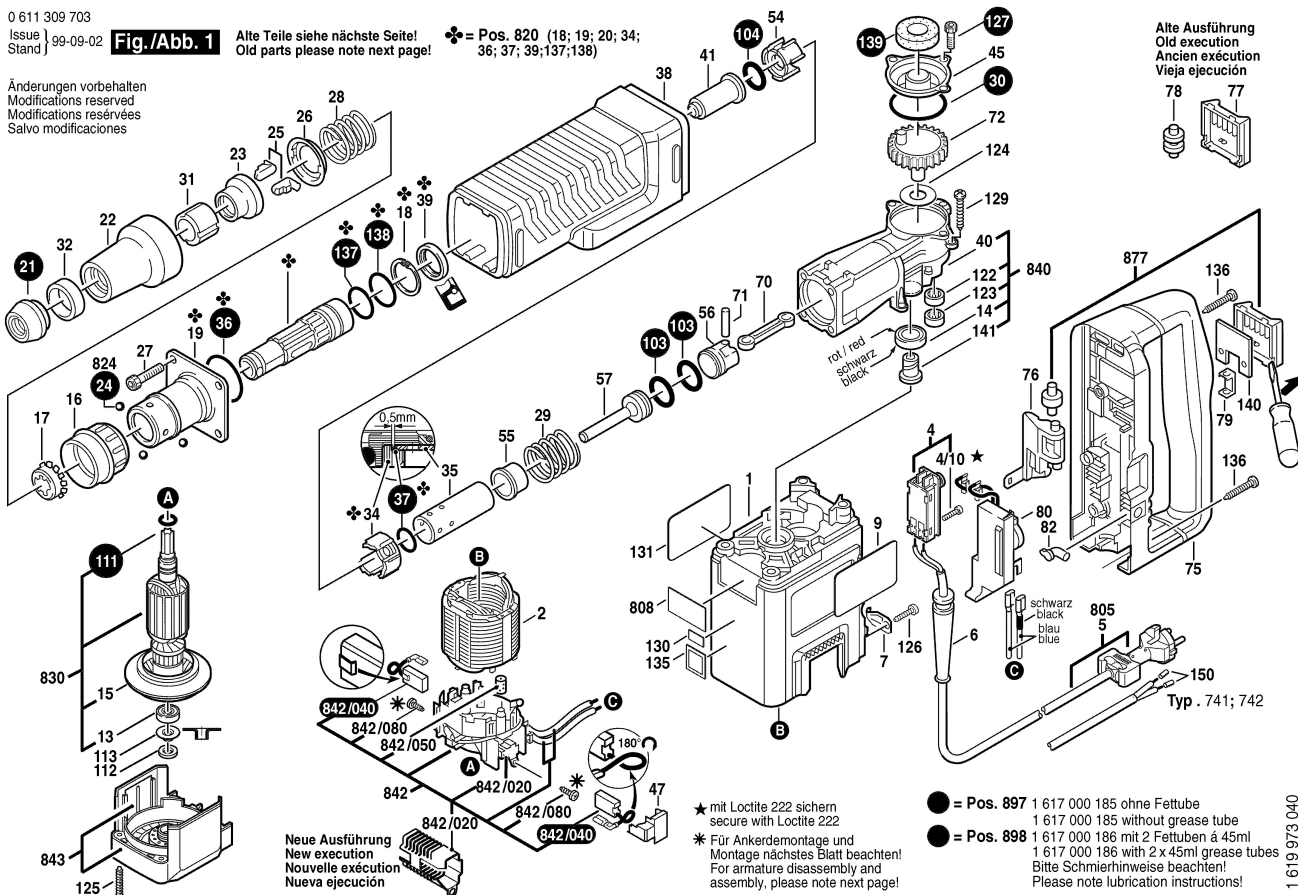


Fig./Abb. 1


Alte Teile siehe nächste Seite!
Old parts please note next page!

✱ = Pos. 820 (18; 19; 20; 34;
36; 37; 39; 137; 138)

Änderungen vorbehalten
Modifications reserved
Modifications réservées
Salvo modificaciones

**Fig./Abb. 2**

Änderungen vorbehalten
Modifications reserved
Modifications réservées
Salvo modificaciones

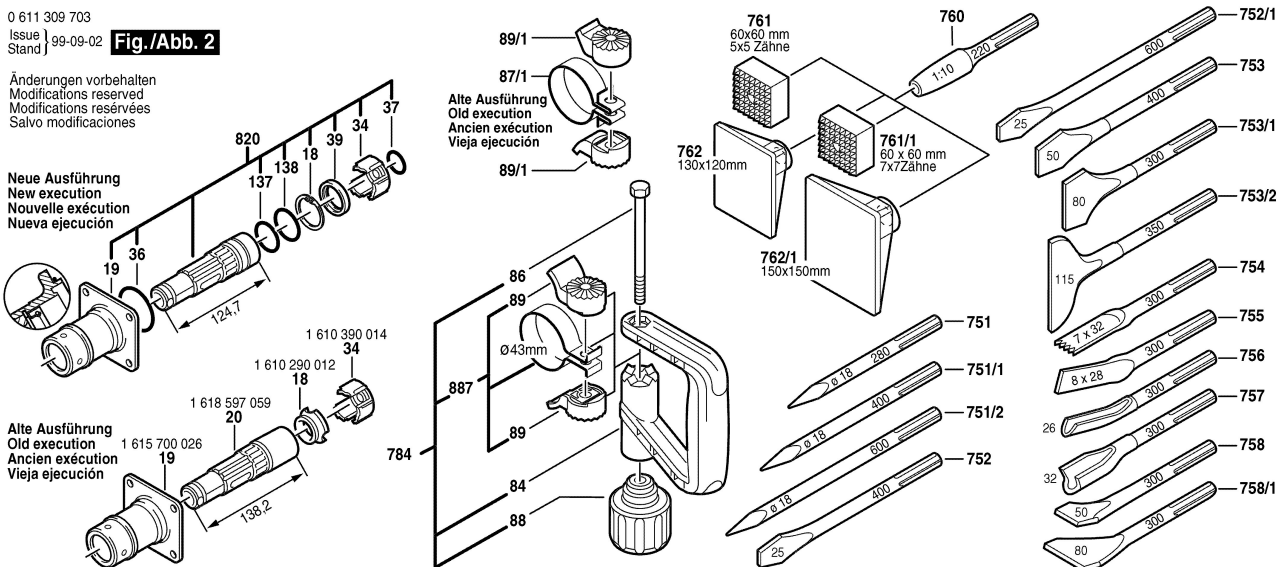

Vor Ankerdemontage- und Montage beide
Bürstenhalter 5-7 mm nach außen ziehen.
For armature disassembly and assembly
pull the brush holder 5-7 mm outwards.

Nach der Ankerdemontage Bürstenhalter
nach innen drücken und festschrauben.
After armature assembly, press in the
brush holder and tighten the screw.

Kohlebürsten mit Flach-
stecker einsetzen.
Fit brushes and electrical
contact.

Litzen beider Kohlebürsten
um 180° drehen.
Turn both the brush wires
180° as shown.

Abstand herstellen (min. 1mm) zwischen
Flachstecker und Kohlebürstenhalter.
In order to fit pos. 47 there must be at least
1 mm distance between the brush holder and the
electrical contact. Press pos. 47 firmly into position.

